

ZR-132S Platform Scale





- · All stainless steel platform and column
- · 4 levels of auto hold function to weigh big-size objects
- ·High/ok/low weight checking function, with visual and sound indicator
- ·Memory of 20 digital tares
- •Memory of 50items for the parts counting function
- · Programmable auto-off





The best one in its category.



- LCD display with automatic bright backlighting.
- · 4 levels of auto hold function to weigh big-size objects.
- High/ok/low weight checking function, with visual and sound indicator.
- · Classifying by weight.
- · Memory of 20 digital tares.
- · Last weighing memorization.
- . Memory of 100 items for the parts counting function.
- PC or printer connection or remote display (optional).
- · Programmable auto-off.
- · Automatic tare.







Everything is possible with ZR-132 indicator.

Many placement positions.





ZR-132S



Supports With the appropriate support it can be adapted for use in column or wall.

ZR-132



It can be placed on the desktop or, simply by easy 180-degree turning of its upper part, it adapts to the wall placement.







Wall fixation The indicator can be set on the wall.



Supports With the appropriate support it can be adapted for use in column or wall.



Connectivity


With optional data output RS-232C compatible with our Pr3 printer or PC. Data output for printer in 4 languages and in 5 different print formats. Connection for Relay output options and analog output 0/20mA.



AC power supply and rechargeable battery

Inner watertight AC power and optional rechargeable battery allow using it in any situation included far away from power outlets.



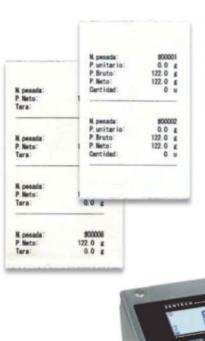

Tickets printing

Weighing data (net weight, gross weight, tare, parts, etc.), in 5 printer formats in Spanish, English, French and German. Accumulative weighing with total weight printing.



Auto Hold function

You can weigh large objects first and then read its weight from the display. 4 levels of auto hold function to weigh large-sized objects



Tare pedal (optional)

With this useful pedal you can operate tare function without touching the scale.

Technical features

Model	ZR-132	ZR-132S
Code	6170	6171
Rang and divisions	Double rang/100.000 div. No OIML	
Converter A/D	24 Bite	
Pre-heating time	1 hour	
Stabilization time	2 seconds	
Calibration weight (external calibration models)	To select	
Available quantities to enter the sample to counting parts	10,20,50,100,depending on the choice	
Weighing units	g (kg), lb, oz/lb	
Interface	RS232C and TTL	
Air humidity	max.99%	
Indicator material	ABS	Stainless steel
Watertight protection	IP-65	IP-67
Indicator size (mm)	220 x180 x 83	220 x190 x 85
Total net weight (kg)	1.5	2.5

Available options:

- · Battery
- · Relay output
- 0-20 mA analogical output
- External tare output
- Double data output: printer and RS-232C
- PR3 Printer
- RD-3 remote display
- Tare pedal
- · Wall / Column support, swaying

Technical specifications:

Power: 230 V / 50 Hz (Euro) 11 V AC Battery: Operation time 30/60 hours Operation temperature: +5°C /+35°C

External dimensions (mm)

